

Date: Friday, 1/27/2006 7:52:53 AM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 206 L HIGH GEAR SKIDTUBE
Job Number : 25631A	
Estimate Number : 10539	
P.O. Number : N/A	Part Number : D206642341
This Issue : 1/27/2006 S.O. No. : N/A	Drawing Number : D2650 REV D1
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A Type : LANDING GEAR	Drawing Revision : D1
Previous Run : 25630A	Material : N/A
Written By : <u>SEE COMMENT BELOW</u>	Due Date : 2/20/2006 Qty: 1 Um: Each
Checked & Approved By : <u>06-01-27</u>	
Comment : Est Rev: H 0540.11 Added D3429-1 per CHG004 KJ/CP/JLM	

## Additional Product

Job Number:

Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-341CHG002

2.0	D2620	Bent 206 Skidtube
-----	-------	-------------------

Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	D2620	Bent Tube 3" OD	B24497 DP06-2-6 ①
---	-------	-----------------	-------------------

3.0	D2647	Cap
-----	-------	-----

Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	D2647	Fwd Cap	B20535 BE 06-02-07 ①
---	-------	---------	----------------------

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------

Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube DP 06-2-6 ①

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650 DP 06-2-6 ①

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod M15855 / M19100 BE 06-02-07 ①

4-Grind weld flush to cap on top surface only. BE 06-02-07 ①

## WORK ORDER CHANGES

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

## WORK ORDER NON-CONFORMANCE (NCR)

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action      Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/27/2006 7:52:53 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Cut aft end to length as per dwg D2650

DP 06-2-8 ①

6-Drill pilot holes using drill Jig DT8168A (A,B & C). Open to Ø0.312"

DP 06-2-8 ①

7-Drill holes for wearplates using DT 8028-7. Open to Ø 0.297".

DP 06-2-8 ①

8-Open using #6 Drill Bit

DP 06-2-8 ①

9-Open holes for Tow Ring to Ø0.640" as per Dwg D2650, D2650-5 Drilling Detail

DP 06-2-9 ①

10-Remove inner indexing ridge on aft end of skidtube as per Dwg D2650

DP 06-2-9 ①

11-Deburr and Blow out all chips from inside the tube

DP 06-2-9 ①

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

F.F. 06-02-09

6.0

D26545

206 L Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number  
1 D2654-5

Description  
Web

Batch

B21093

BE  
IT 06-02-13 ①

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-5 Drilling Detail (without cutting fluid)

BE  
IT 06-02-13 ①

2-Countersink crossbolt spacer holes as per Dwg D2650 (without cutting fluid)

BE  
IT 06-02-13 ①

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

BE  
IT 06-02-13 ①

4-Bond D2654-5 web in place as per QSI 015 Ensure holes line up Allow 12 Hrs. cure time before cutting

Start Date: 06-02-13

Time: 2:30 pm BE/IT 06-02-13

Finish Date: 06-02-14

Time: 3:00 pm

A/R Sikaflex-291

0119597

Sikaflex expiry date:

06-06-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/27/2006 7:52:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description:

8.0

QC5

INSPECT WORK TO CURRENT STEP



*June 02-15*

Comment: INSPECT WORK TO CURRENT STEP

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 17.0000 Each(s)/Unit Total: 17.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

17 D2649

Crossbolt spacer

*B 24200 BE 06-02-15 (1)*

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod

*m18239 BE 06-02-15 (1)*

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

*Pm 06-02-17 (1)*

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Deburr

*Pm 06-02-17 (1)*

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2680-041

Nut Plate

*621103*

*Pm 06-02-17 (1)*

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 CCR264SS3-3

Rivets

*m18518*

*Pm 06-02-17 (1)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/27/2006 7:52:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets

m7808

Pm 06-02-17

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

Pm 06-02-17

15.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

PD 06-02-20

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

06-02-08

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DL 06/07/10 (1)

18.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

B 25904

19.0

D265611

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-11

Wearshoe

B 16357

06-07-10

(1)

## WORK ORDER CHANGES

PROCEDURE CHANGE

By

Date

Qty

Approval  
Chief Eng /  
Prod Mgr

Approval  
QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:

## WORK ORDER NON-CONFORMANCE (NCR)

DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Friday, 1/27/2006 7:52:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe

B24846

21.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-35

Wearshoe

B24148

22.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B 216624

23.0

ALS41032130

Insert



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 ALS4-1032-130

Inserts

M18293

or (see QSI 017)

24.0

AN960JD10L

Washer



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 AN960JD10L

Washer

M101291

q.m 06-07-10

①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/27/2006 7:52:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

MS27039108

Screw



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 MS27039-1-08

Screw m19551

26.0

D26511

Plug



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-1

Plugs B2S144

27.0

D26513

O-Ring



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-3

O-Rings B2S866

28.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer m1151

29.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw m6874

a-m 06-07-10

①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/27/2006 7:52:54 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2646

Aft Cap B25381

31.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 AN960JD10L

Washer m101291

32.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 MS27039-1-08

Screw m1551

9.m 06-07-10 (1)

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

m101193

Sikaflex expiry date:

06-11-06

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

m101193

Sikaflex expiry date:

06-11-06

9.m 06-07-10 (1)

6-Wing Walk as per Dwg D2650-5 and QSI 005 4.4

Batch: m101266

FC 06 07 10 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 06/07/13  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/27/2006 7:52:55 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 25631A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

*Dr 06/07/11 (1)*

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: \_\_\_\_\_

*N/A*

36.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

*DP 06/07/13 (1)*

Job Completion



*W 06/07/13*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries





DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2650	REV. D SHEET 1 OF 5
DATE 04.05.17		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	

**RELEASED**  
04.06.22 *[Signature]*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

#### NOTES


- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 25631A

Copyright © 1997 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 25631A

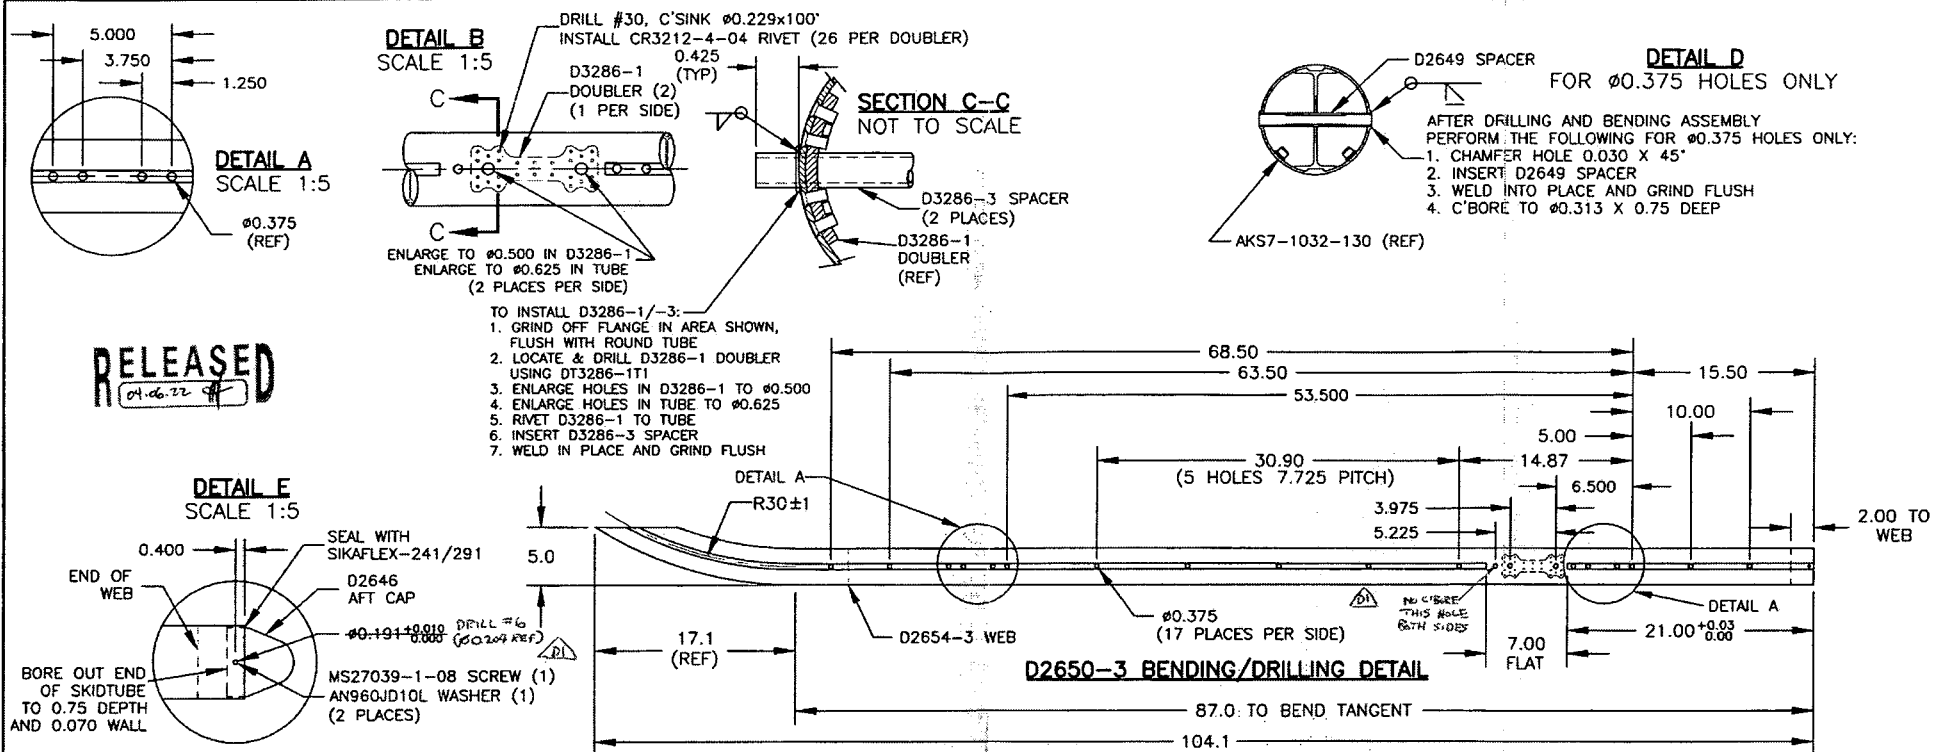

**DETAIL F (NOT TO SCALE)**


- CUT TUBE LEVEL
- REMOVE RIDGE ON FWD SIDE
- LOCATE D2647 (TRIM AS NECESSARY)
- WELD D2647 IN PLACE PER DART QSI 004
- GRIND FLUSH
- RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

- CCR264SS3-3 RIVET (2 PLACES)
- MS27039-4-06 SCREW (1)  
AN960JD416 WASHER (1)  
CR3212-4-03 RIVET (2 PLACES)  
D2680-041 NUTPLATE (1)  
D2647 CAP (1)
- 1/16

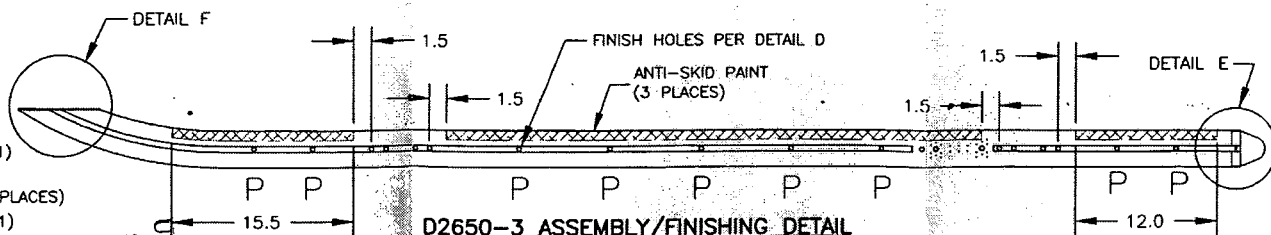

NO. 25631 A

WORK ORDER

SHOP COPY

RETURN TO



ENGINEERING

UNCONTROLLED COPY

SUBJECT TO AMENDMENT

WITHOUT NOTICE



COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	UP	DRAWN BY	UP	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	JP	APPROVED	JP	DRAWING NO. D2650	REV. D
		DATE	04.05.17			TITLE SKIDTUBE	SHEET 3 OF 5
						SCALE	1:10

  

— AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:

1. CHAMFER HOLE 0.030 X 45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE TO Ø0.313 X 0.75 DEEP


RELEASED  
04.06.22

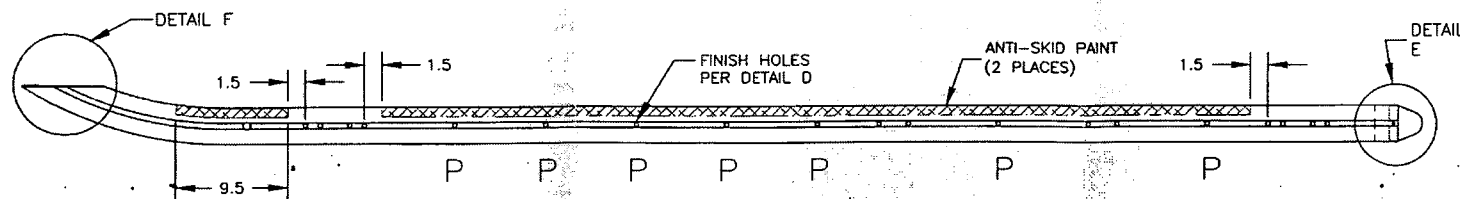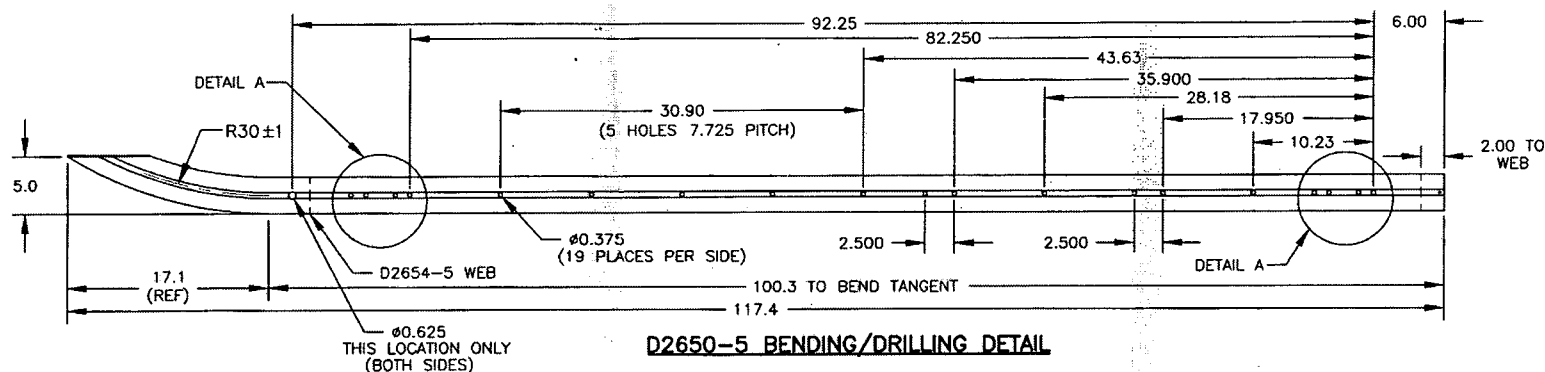

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE  
IN PLACE

 NOTE: MASK THREADS IN  
D2680-041 PRIOR TO  
FINISH




REMOVE RIDGE ON  
INSIDE OF SKIDTUBE  
LEAVE 0.070 MIN.

- CCR2645S3-3 RIVET (2 PLACES)
- MS27039-4-06 SCREW (1)
- AN96QJD416 WASHER (1)
- CR3212-4-03 RIVET (2 PLACES)
- D2680-041 NUTPLATE (1)
- D2647: CAP (1)

## D2650-5 ASSEMBLY/FINISHING DETAIL

 SHOP COPY  
 RETURN TO  
 ENGINEERING  
 UNCONTROLLED COPY  
 SUBJECT TO AMENDMENT  
 WITHOUT NOTICE  
 WORK ORDER  
 NO. 25031A

D2680-041 PRIORITY TO  
 FINISH  
 D2680-041 NOT PLATE (1)  
 D2647 CAP (1)  
 1/16  
 1.0  
 REMOVE RIDGE ON  
 INSIDE OF SKIDTUBE  
 LEAVE 0.070 MIN.  
 ORIENTATION OF  
 D2680-041

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, MA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED <i>H</i>	APPROVED <i>H</i>	DRAWING NO. <b>D2650</b>	REV. D SHEET 4 OF 5
DATE <b>04.05.17</b>		TITLE <b>SKIDTUBE</b>			

